


## Removing and installing light sensor -G399-

Special tools and workshop equipment required


## t Improvised tool

- Use 0.7 mm thick metal strip to make suitable tool with dimensions in mm as shown in illustration.

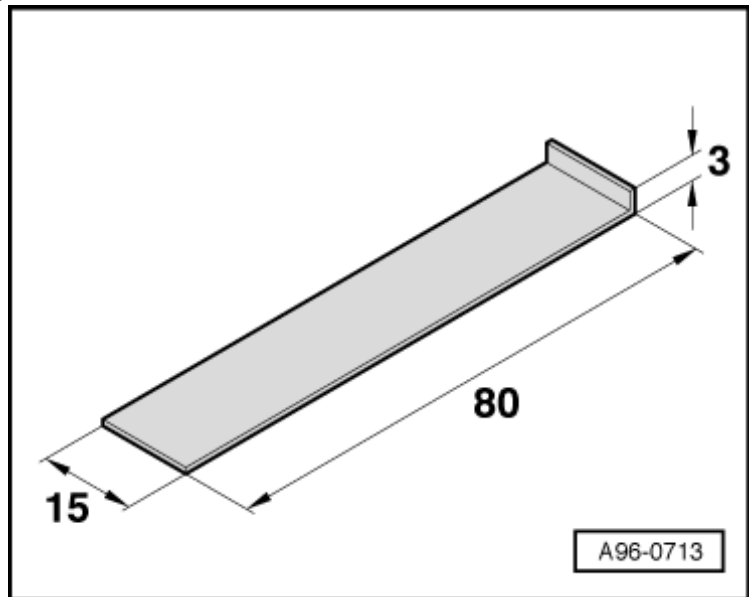

## Removing

- Guide offset end of improvised tool -1- under side of trim -2- as shown.
- Release retaining tabs of trim by pulling improvised tool in direction of arrow.
- Repeat procedure on opposite side.

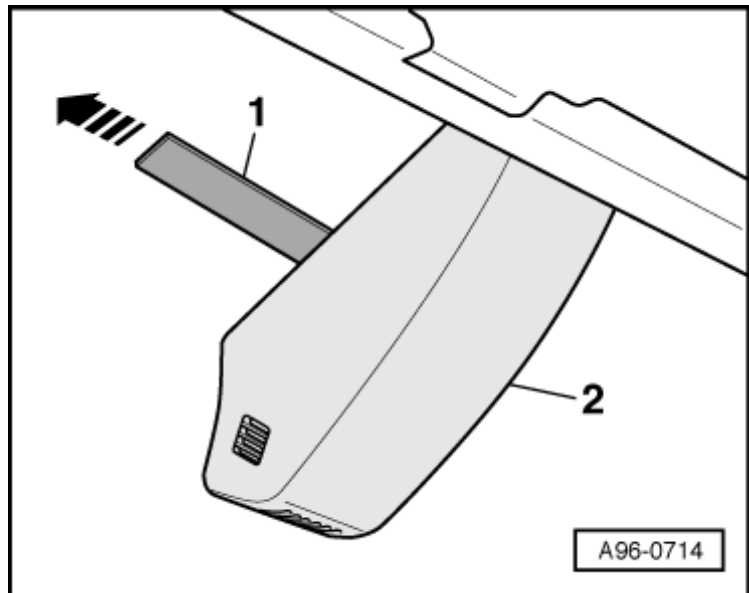

- Unplug electrical connector -1-.
- Press retaining clips together -arrows- and take light sensor -G399--item 2- out of mounting.

## Installing

Install in reverse order.

